

Report No.	:	ххх	Re - Inspection
Client Name	:	XXX	
Order / P.O / P.I No.	:	26265	
Product Description	:	5.5in Infinity Cube Light	
Product Item / Part No.	:	MI-LNL63-999W	
Product Quantity	:	5,000Pcs	
Supplier Name	:	XXX	
Inspection Date	:	2024-06-11	
Inspection Location	:	Jiangmen city, Guangdong province, China.	

WORKMANSHIP INSPECTION PLAN AND DEFECTS QTY

Inspection Standard: ANSI/ASQC Z 1.4-2003			AQI	L S	tandard	Allow Defects QTY	Actual Defects QTY
Sampling Plan	:	Single Normal	Critical	:	0	0	0
Inspection Level	:	GII	Major	:	2.5	10	0
Total Sample Size	:	200	Minor	:	4.0	14	10

INSPECTION DETAILS RESULT

1)	QUANTITY	:	Conform
2)	WORKMANSHIP	:	Conform
3)	ARTWORKS	:	Conform
4)	PACKAGING	:	Not Conform, Refer to Special Attentions:1
5)	SHIPPING MARK	:	Conform
6)	TESTING / DATA MEASUREMENT	:	Not Conform, Refer to Special Attentions:2-3
		_	

INSPECTION OVERALL CONCLUSION

: ACCEPTED

X FAILED

PENDING


SPECIAL ATTENTION

1	Missing protect paper card on top and bottom of carton, but information was required. Refer Pic.A
2	Customer require product weight was not less than 420g, but the actual product weight is 342g. Refer to Pic.B
3	Factory did not allow to do carton drop test.
4	

Name(s) of Inspec	ctor(s)		Name of Reviewer		
2024-06-11	Steven		2024-06-12	Chuck Shi	Chuck shi
Date	Name	Signature	Date	Name	Signature
their contractual		om the buyer's right for co			ve the seller/manufacturer of hidden defects not detected
					Dago 1 of 17

			Fage 10117
HONOR INSPECTION INTERNATIONAL LTD. NINGBO REPRESENTATIVE OFFICE.	Rm.305,No.1 Building,No.568. SiMing EastRoad,YinZhou District, NingBo City, China.	Tel: +86-574-88197698 Fax: +86-574-88197638-8	Email: report@honorinspection.com Web: www.honorinspection.com Report Version:20150606



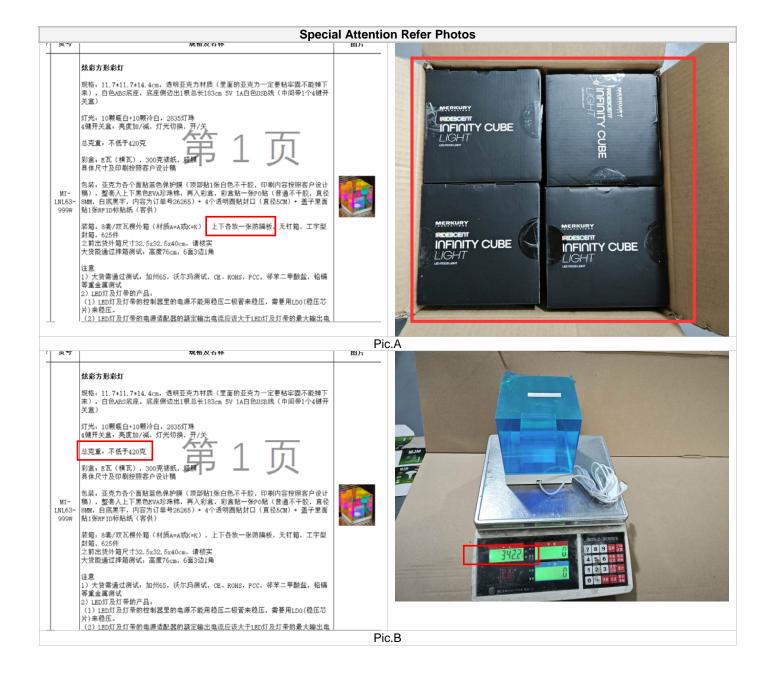

Rm.305,No.1 Building,No.568. SiMing EastRoad,YinZhou District, NingBo City, China. Tel: +86-574-88197698 Fax: +86-574-88197638-8 Page 2 of 17

Email: report@honorinspection.com Web: www.honorinspection.com Report Version:20150606

NINSPECTION




RANDOM SAMPLING PLAN FOR EACH ITEM

1)	QUANTITY											
Result:	Conform											
		Order	Packed	Not packed	Not finished	Sampling Size						
No.	Item / Part No.	Quantity	Quantity	Not packed Quantity	Quantity	Packed Quantity	Not packed QTY					
1	MI-LNL63-999W	5,000	5,000	0	0	200	0					
	Total	5,000	5,000	5,000 0 0 200 0			0					

The ins	pection details were found as follows:			
2)	WORKMANSHIP			
Result:	Conform			
Defects	Description	Critical	Major	Minor
Item No.:	MI-LNL63-999W	De	fects QT	Ϋ́
1.Glue m	ark (Refer to Pic.1-6)	0	0	6
2.Dirt ma	rk (Refer to Pic.7-8)	0	0	2
3.Gap ma	ark (Refer to Pic.9)	0	0	1
4.Impurity	(Refer to Pic.10)	0	0	1
	Individual Total Found:	0	0	10
	Total Defects Found:	0	0	10
	AQL Standard Allowed:	0	10	14

Appearance Defects Refer Photos

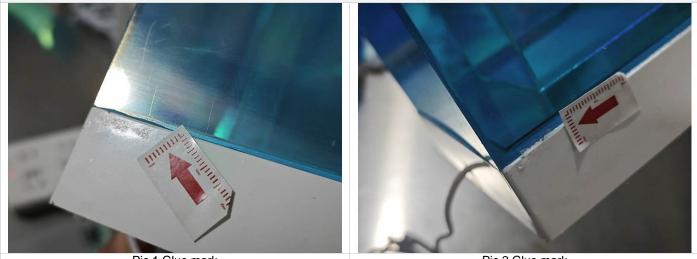

Pic.1 Glue mark

Pic.2 Glue mark

HONOR INSPECTION INTERNATIONAL LTD. NINGBO REPRESENTATIVE OFFICE.

Rm.305,No.1 Building,No.568. SiMing EastRoad, YinZhou District, NingBo City, China.


Tel: +86-574-88197698 Fax: +86-574-88197638-8 Page 3 of 17

Email: report@honorinspection.com Web: www.honorinspection.com Report Version:20150606

NINSPECTION





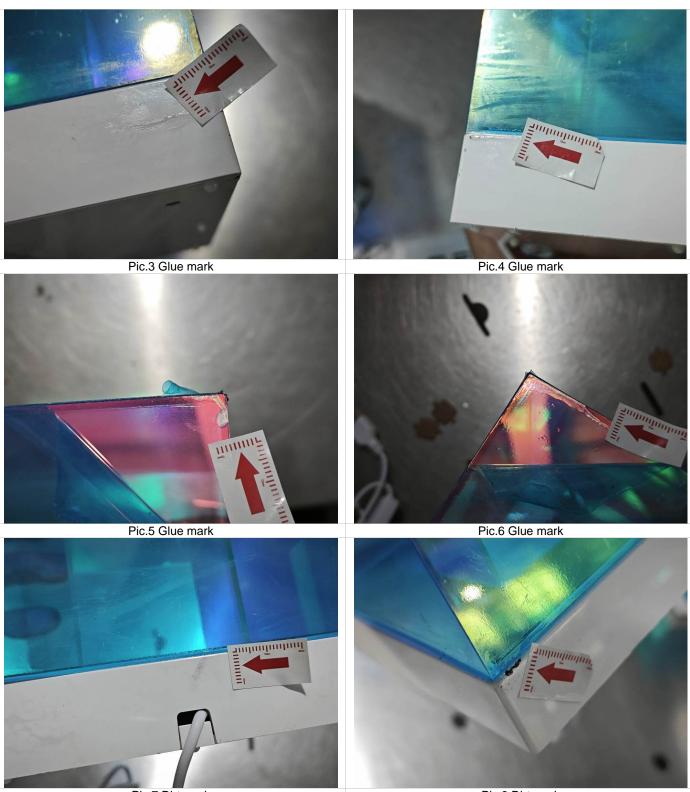

Pic.7 Dirt mark


Pic.8 Dirt mark

HONOR INSPECTION INTERNATIONAL LTD. NINGBO REPRESENTATIVE OFFICE.

Rm.305,No.1 Building,No.568. SiMing EastRoad,YinZhou District, NingBo City, China. Tel: +86-574-88197698 Fax: +86-574-88197638-8 Page 4 of 17





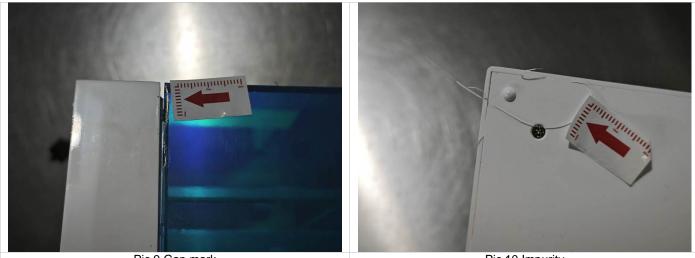

Pic.9 Gap mark

Pic.10 Impurity

3)	ARTWORKS	
Result:	Conform	
	Markings/ logos/ labels on the gift box	Conform
	Markings/ logos/ labels on the product	Conform
	Color of product	Conform
	Instruction Manual	Conform
	Bar code/ QR code	Conform
	Others-	

Barcode Readability Check					05	Sa	mples)	Conform	
Item No	Specification	Actual	Iten	n No			Specif	icat	ion	Actual
MI-LNL63-999W	20194383061650	20194383061650	MI-I	_NL63	3-999W		194383	306	1656	194383061656
Data Red color marked was/were found out of specification.										

4) F	PACKAGING								
Result: N	Not Confo	rm, Refer to Specia	I Attentions:1						
Item No	em No Accessories U			Unit Packing	Unit Packing				
MI-LNL63-9	999W				ch piece packed per gift box with 8pcs onge, 8pcs per carton				
		Data	Red color marked was	s/were found out of s	pecification.				
Dimension	n of carto	n (L×W×H cm)		(03	Samples) Cont	form			
Item No		Specification	Actual	Item No	Specification	Actual			
MI-LNL63-9	999W	32x32x39.5	32x32.5x40.5						
		Data	Red color marked was	s/were found out of s	pecification.				

Weight of carton	(Kgs)		(03	Samples) Confo	rm
Item No	Specification	Actual	Item No	Specification	Actual
MI-LNL63-999W	5.0	4.63			
	Data	Red color marked wa	as/were found out of s	specification.	

HONOR INSPECTION INTERNATIONAL LTD. NINGBO REPRESENTATIVE OFFICE.

Rm.305,No.1 Building,No.568. SiMing EastRoad,YinZhou District, NingBo City, China. Tel: +86-574-88197698 Fax: +86-574-88197638-8 Page 5 of 17







6)	TESTING / DATA MEASUREMENT					
Result:	Not Conform, Refer to Special Attentions:2-3					
	LED light function test	(200	Samples)	Conform
	Dimension check	(05	Samples)	Not Conform
	Aging test	(05	Samples)	Conform
	Product inside check	(01	Samples)	Conform
	Drop test on outer carton (H=76 cm)	(00	Carton)	Not Conform



HONOR INSPECTION INTERNATIONAL LTD. NINGBO REPRESENTATIVE OFFICE. Rm.305,No.1 Building,No.568. SiMing EastRoad,YinZhou District, NingBo City, China. Tel: +86-574-88197698 Fax: +86-574-88197638-8

Page 6 of 17









Warehouse view

MI-LNL63-999W


Warehouse view



HONOR INSPECTION INTERNATIONAL LTD. NINGBO REPRESENTATIVE OFFICE. Rm.305,No.1 Building,No.568. SiMing EastRoad,YinZhou District, NingBo City, China. Tel: +86-574-88197698 Fax: +86-574-88197638-8 Page 7 of 17





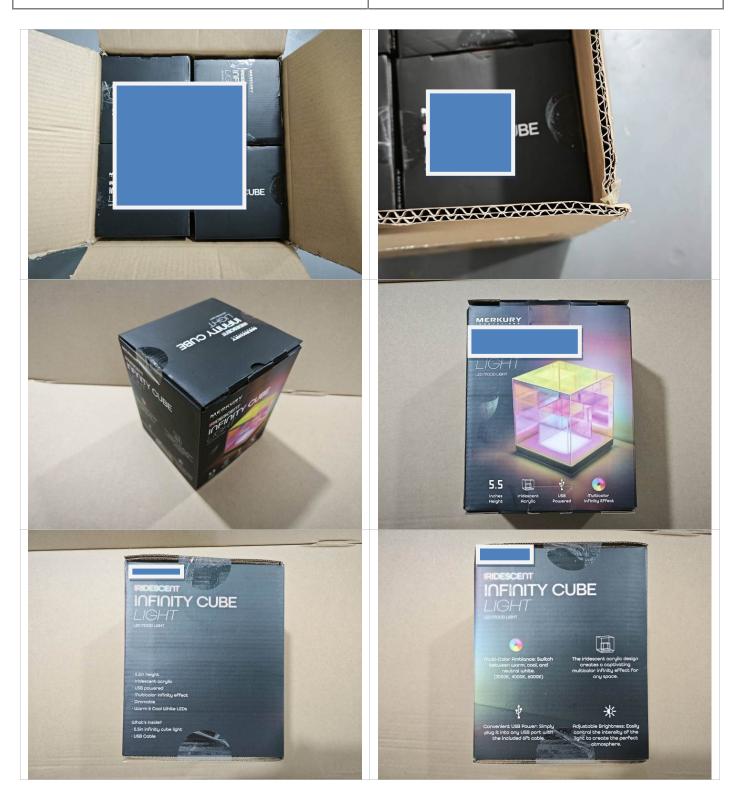

HONOR INSPECTION INTERNATIONAL LTD. NINGBO REPRESENTATIVE OFFICE.

Rm.305,No.1 Building,No.568. SiMing EastRoad,YinZhou District, NingBo City, China. Tel: +86-574-88197698 Fax: +86-574-88197638-8

Page 8 of 17








HONOR INSPECTION INTERNATIONAL LTD. NINGBO REPRESENTATIVE OFFICE. Rm.305,No.1 Building,No.568. SiMing EastRoad,YinZhou District, NingBo City, China. Tel: +86-574-88197698 Fax: +86-574-88197638-8

Page 9 of 17





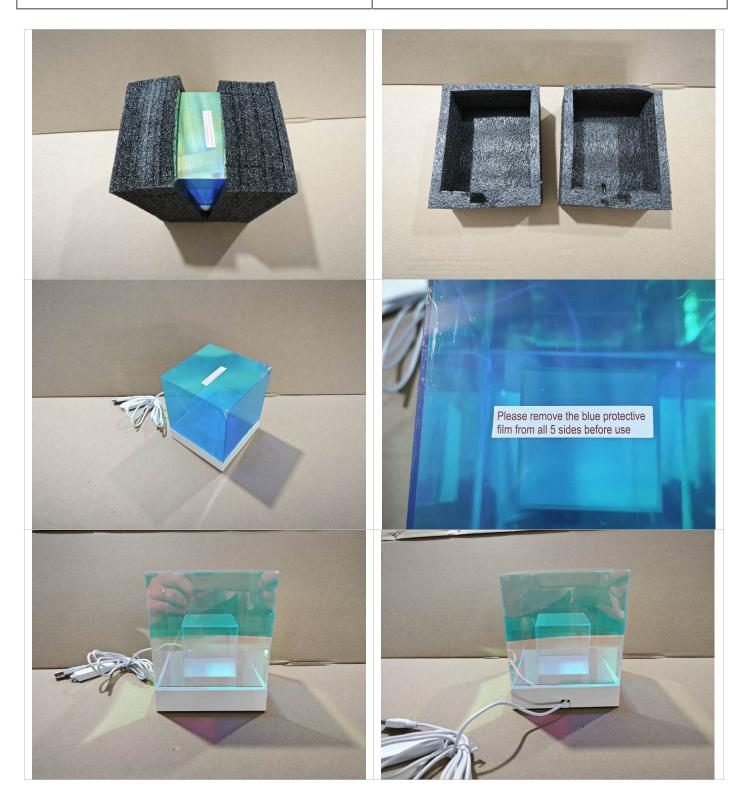


HONOR INSPECTION INTERNATIONAL LTD. NINGBO REPRESENTATIVE OFFICE.

Rm.305,No.1 Building,No.568. SiMing EastRoad,YinZhou District, NingBo City, China. Tel: +86-574-88197698 Fax: +86-574-88197638-8

Page 10 of 17





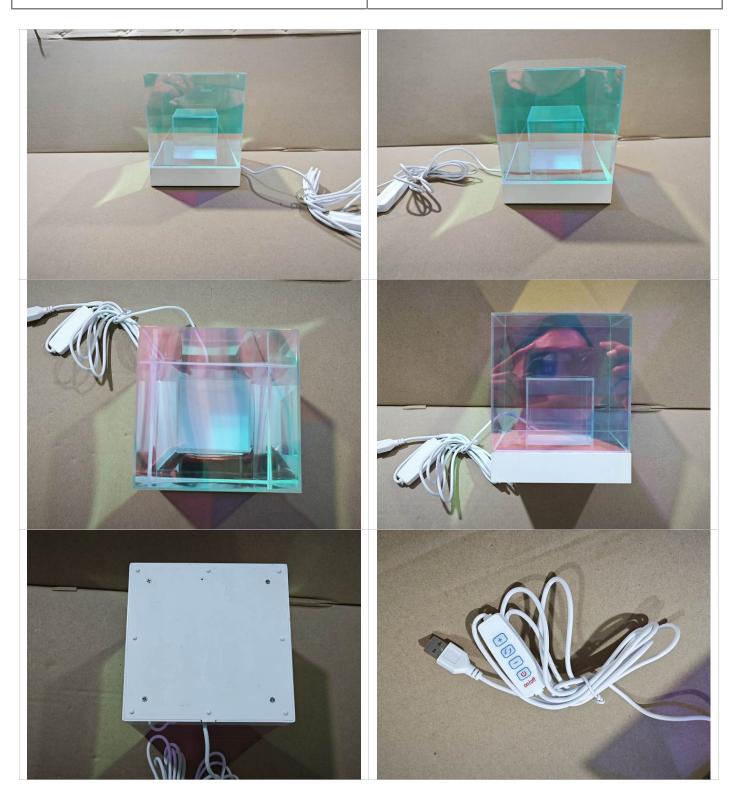



HONOR INSPECTION INTERNATIONAL LTD. NINGBO REPRESENTATIVE OFFICE.

Rm.305,No.1 Building,No.568. SiMing EastRoad,YinZhou District, NingBo City, China. Tel: +86-574-88197698 Fax: +86-574-88197638-8 Page 11 of 17





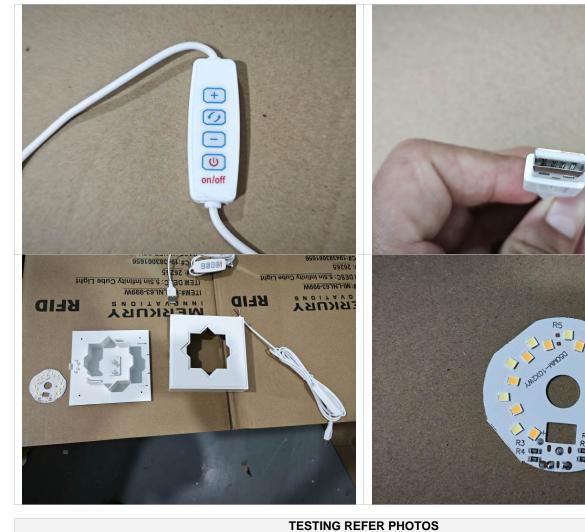

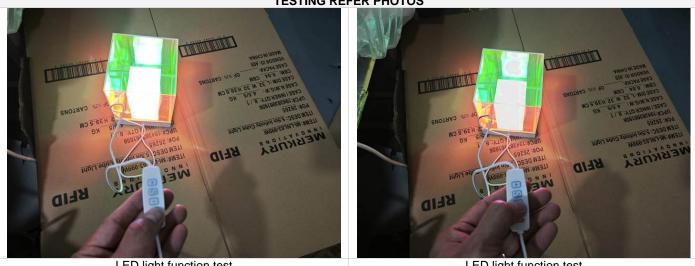

LED light function test


LED light function test

HONOR INSPECTION INTERNATIONAL LTD. NINGBO REPRESENTATIVE OFFICE. Rm.305,No.1 Building,No.568. SiMing EastRoad, YinZhou District, NingBo City, China.

Tel: +86-574-88197698 Fax: +86-574-88197638-8 Page 12 of 17





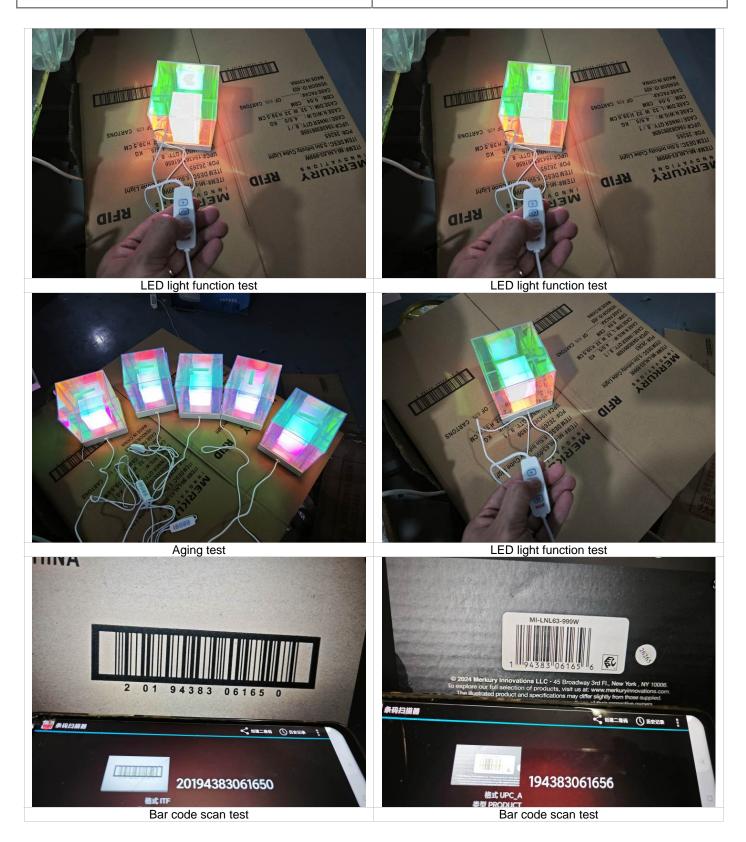


HONOR INSPECTION INTERNATIONAL LTD. NINGBO REPRESENTATIVE OFFICE. Rm.305,No.1 Building,No.568. SiMing EastRoad,YinZhou District, NingBo City, China. Tel: +86-574-88197698 Fax: +86-574-88197638-8

Page 13 of 17





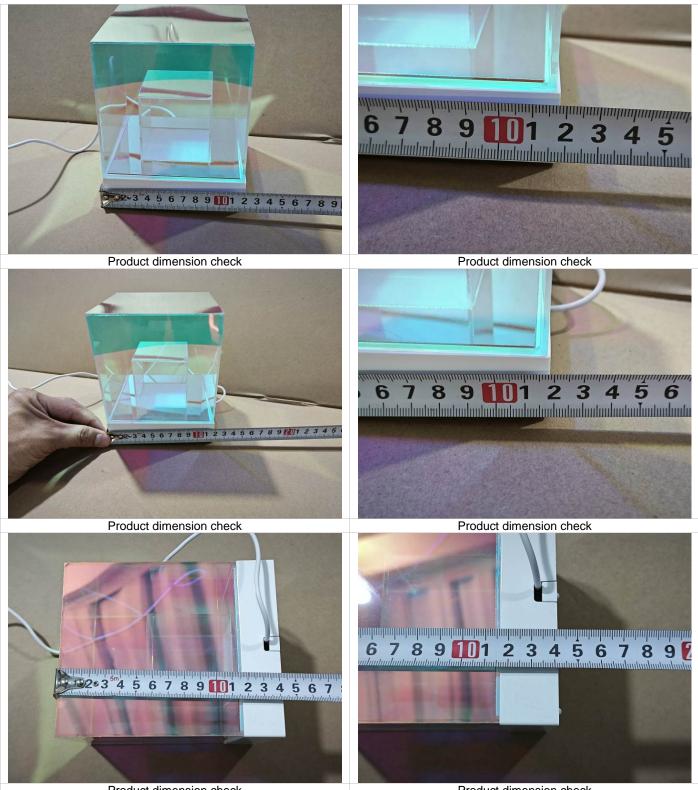

Product dimension check

Product dimension check

HONOR INSPECTION INTERNATIONAL LTD. NINGBO REPRESENTATIVE OFFICE. Rm.305,No.1 Building,No.568. SiMing EastRoad,YinZhou District, NingBo City, China. Tel: +86-574-88197698 Fax: +86-574-88197638-8

Page 14 of 17







Weight of gift box

Weight of gift box

HONOR INSPECTION INTERNATIONAL LTD. NINGBO REPRESENTATIVE OFFICE. Rm.305,No.1 Building,No.568. SiMing EastRoad,YinZhou District, NingBo City, China. Tel: +86-574-88197698 Fax: +86-574-88197638-8 Page 15 of 17







Width of carton

Width of carton

HONOR INSPECTION INTERNATIONAL LTD. NINGBO REPRESENTATIVE OFFICE. Rm.305,No.1 Building,No.568. SiMing EastRoad,YinZhou District, NingBo City, China. Tel: +86-574-88197698 Fax: +86-574-88197638-8 Page 16 of 17



Height of carton

Height of carton

-This is end of Report-

Page 17 of 17